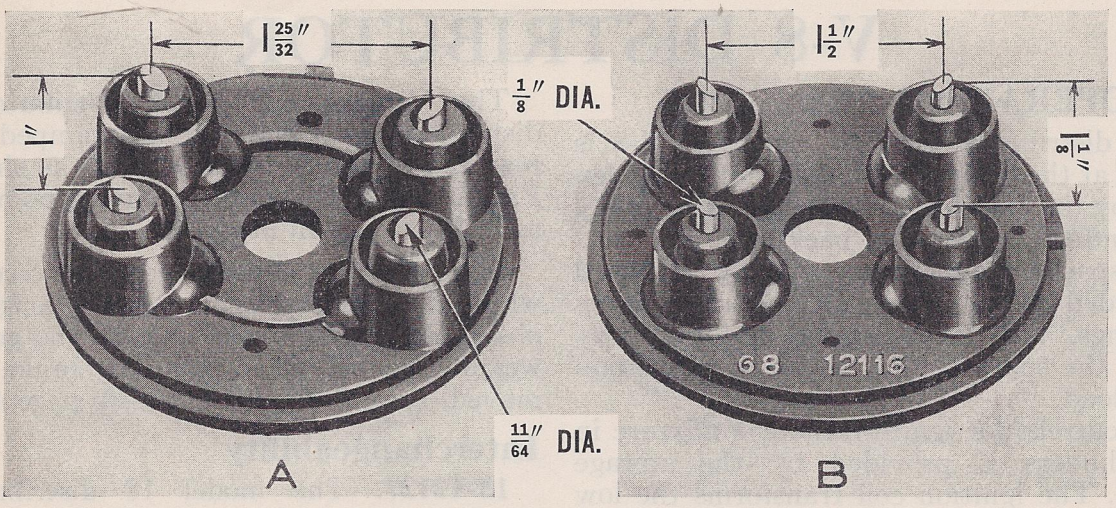



18-12116—Terminal Plate
Fig. 4

68-12116—Terminal Plate
Fig. 5


nal plates (see Figs. 4 and 5) and caps, as these parts are not interchangeable on these distributors. This distributor can be used to replace the 78-12127 distributor except it will be necessary to change coil and condenser.

78-12127 can be used on all models, both cars and trucks except that in replacing distributors prior to 68-12127 it is necessary to likewise change the coil, condenser, terminal plates and caps. When replacing the 68-12127 distributor it will be necessary to likewise change the coil and condenser.

78-12024 coil is not interchangeable with any previous model.

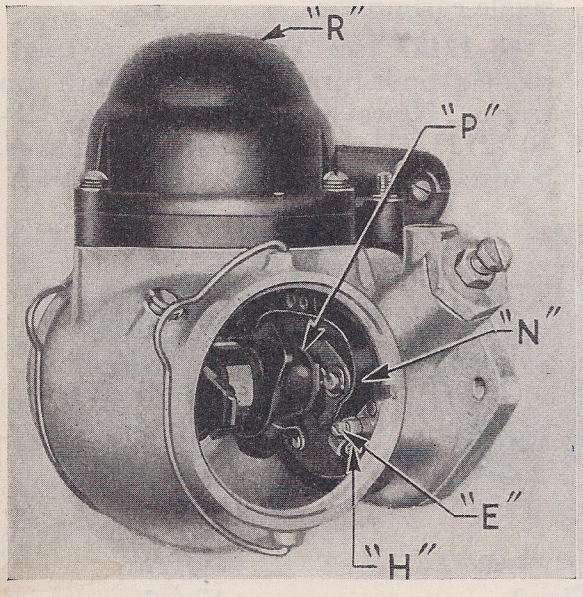

40-12127-B—Distributor
Fig. 6

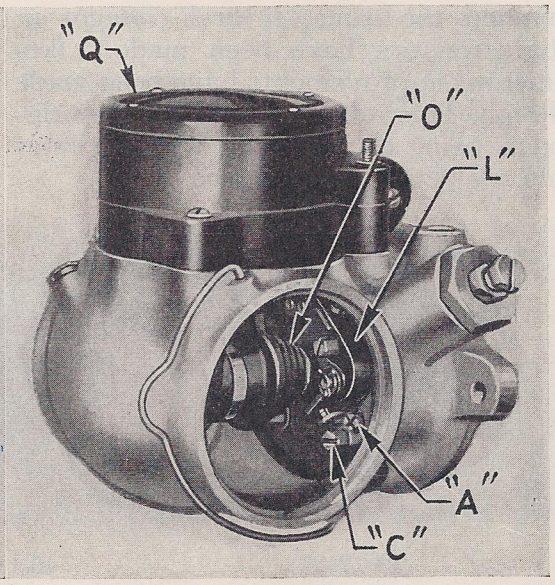

68-12127—Distributor
Fig. 7

ABOVE APPLIES TO MODELS:

ALL FORD V-8

EQUIPMENT USED

HEYER—H1-FORD LABORATORY TEST SET..$135.00
HEYER—H1-DFZ DISTRIBUTOR STROBOSCOPE 35.00

Copyright 1938
FORD MOTOR COMPANY
DEARBORN, MICHIGAN
All rights reserved

Printed in U.S.A.